



M Inline Y Strainer Installation Instructions


Solder Cup Connection

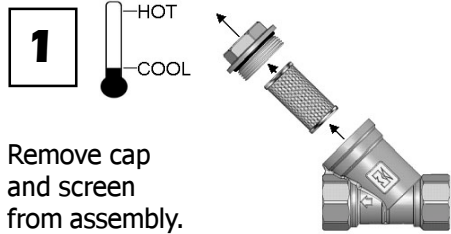


1 Remove cap and screen from assembly.

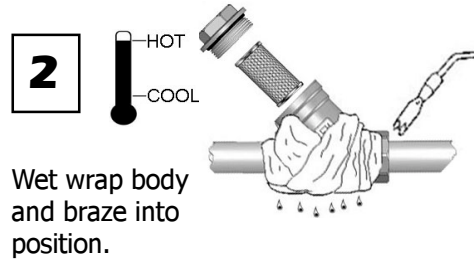

2 Wet wrap body and braze into position.

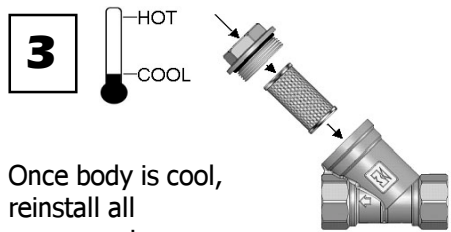


3 Once body is cool, reinstall all components.

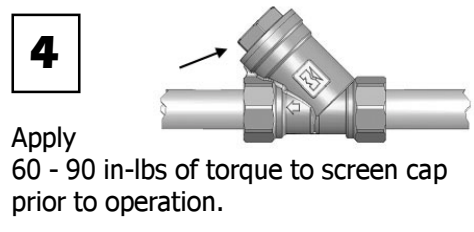


4 Apply 60 - 90 in-lbs of torque to screen cap prior to operation.

Maintenance

Cap

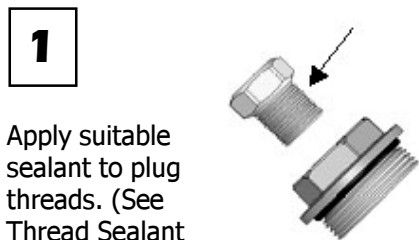

1 Apply suitable sealant to plug threads. (See Thread Sealant Notes.)

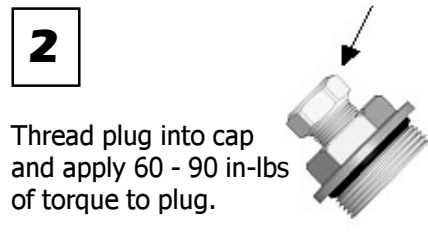


2 Thread plug into cap and apply 60 - 90 in-lbs of torque to plug.

NOTE: Always use two wrenches if tightening or loosening maintenance plug.




M Inline Y Strainer Installation Instructions

Pipe Thread Connection

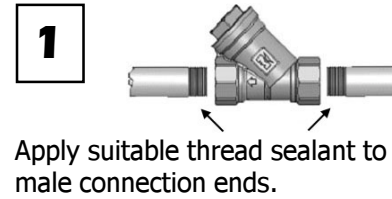

1 Apply suitable thread sealant to male connection ends.

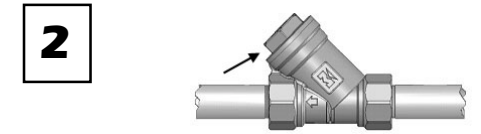


2 After body installation, apply 60 - 90 in-lbs of torque to screen cap prior to operation.


Rebuild Kit: Gasket Replacement




1 Remove and discard old gasket.

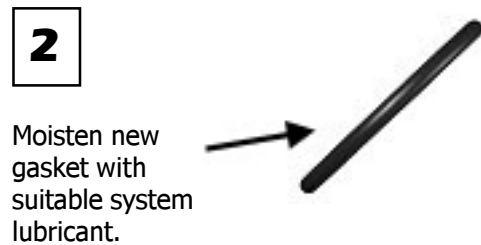

2 Moisten new gasket with suitable system lubricant.

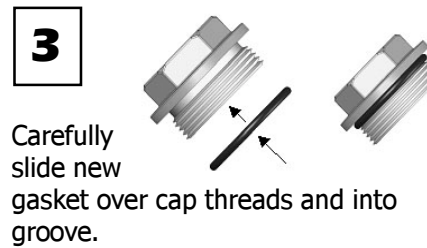

3 Carefully slide new gasket over cap threads and into groove.

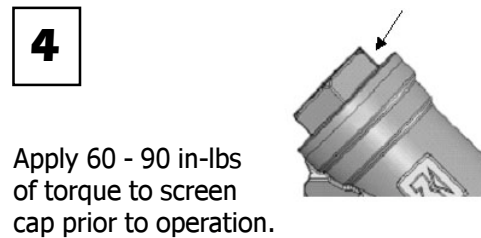

4 Apply 60 - 90 in-lbs of torque to screen cap prior to operation.

Thread Sealant Notes:

1. Ensure threads are clean and free of dirt and other foreign particles.
2. Inspect threads for damage, replace damaged components as necessary.
3. On the Maintenance Plug Threads ONLY, Mueller recommends the use of a thread sealant such as Loctite, Everseal or Teflon Tape. If tape is used, wrap it 3 to 4 times around the plug threads, ensuring at least two-thirds of the threads are covered.